



Observe correct polarity on C16 positive lead toward the middle

Use needle nose pliers & very carefully bend the leads of Q3 up at a 90 degree angle with the center lead off center from the outside leads to match the hole pattern. It is soldered in from the bottom side so the tab can be bolted to the bottom of the case for heat sinking

Observer correct orientation of D1 with band toward the middle

Observe correct polarity on C6 positive lead toward the middle

Top hat heat sink goes on Q2

Tap at 2 1/2 turns from gnd. end

Orient the varicap diode with the flat sides as shown

Audio Input  
Audio ground

